


# Quality Assurance Site Survey Report for Upland

Last updated: May, 2017



AQS ID	ARB Number	Site Start Date	Reporting Agency and Agency Code
060711004	36175	03/1973	South Coast AQMD (061)

Site Address	County	Air Basin	Latitude	Longitude	Elevation
1350 San Bernardino Rd Upland, CA 91786	San Bernardino	South Coast	34° 06' 13"N	117° 37' 45"W	385

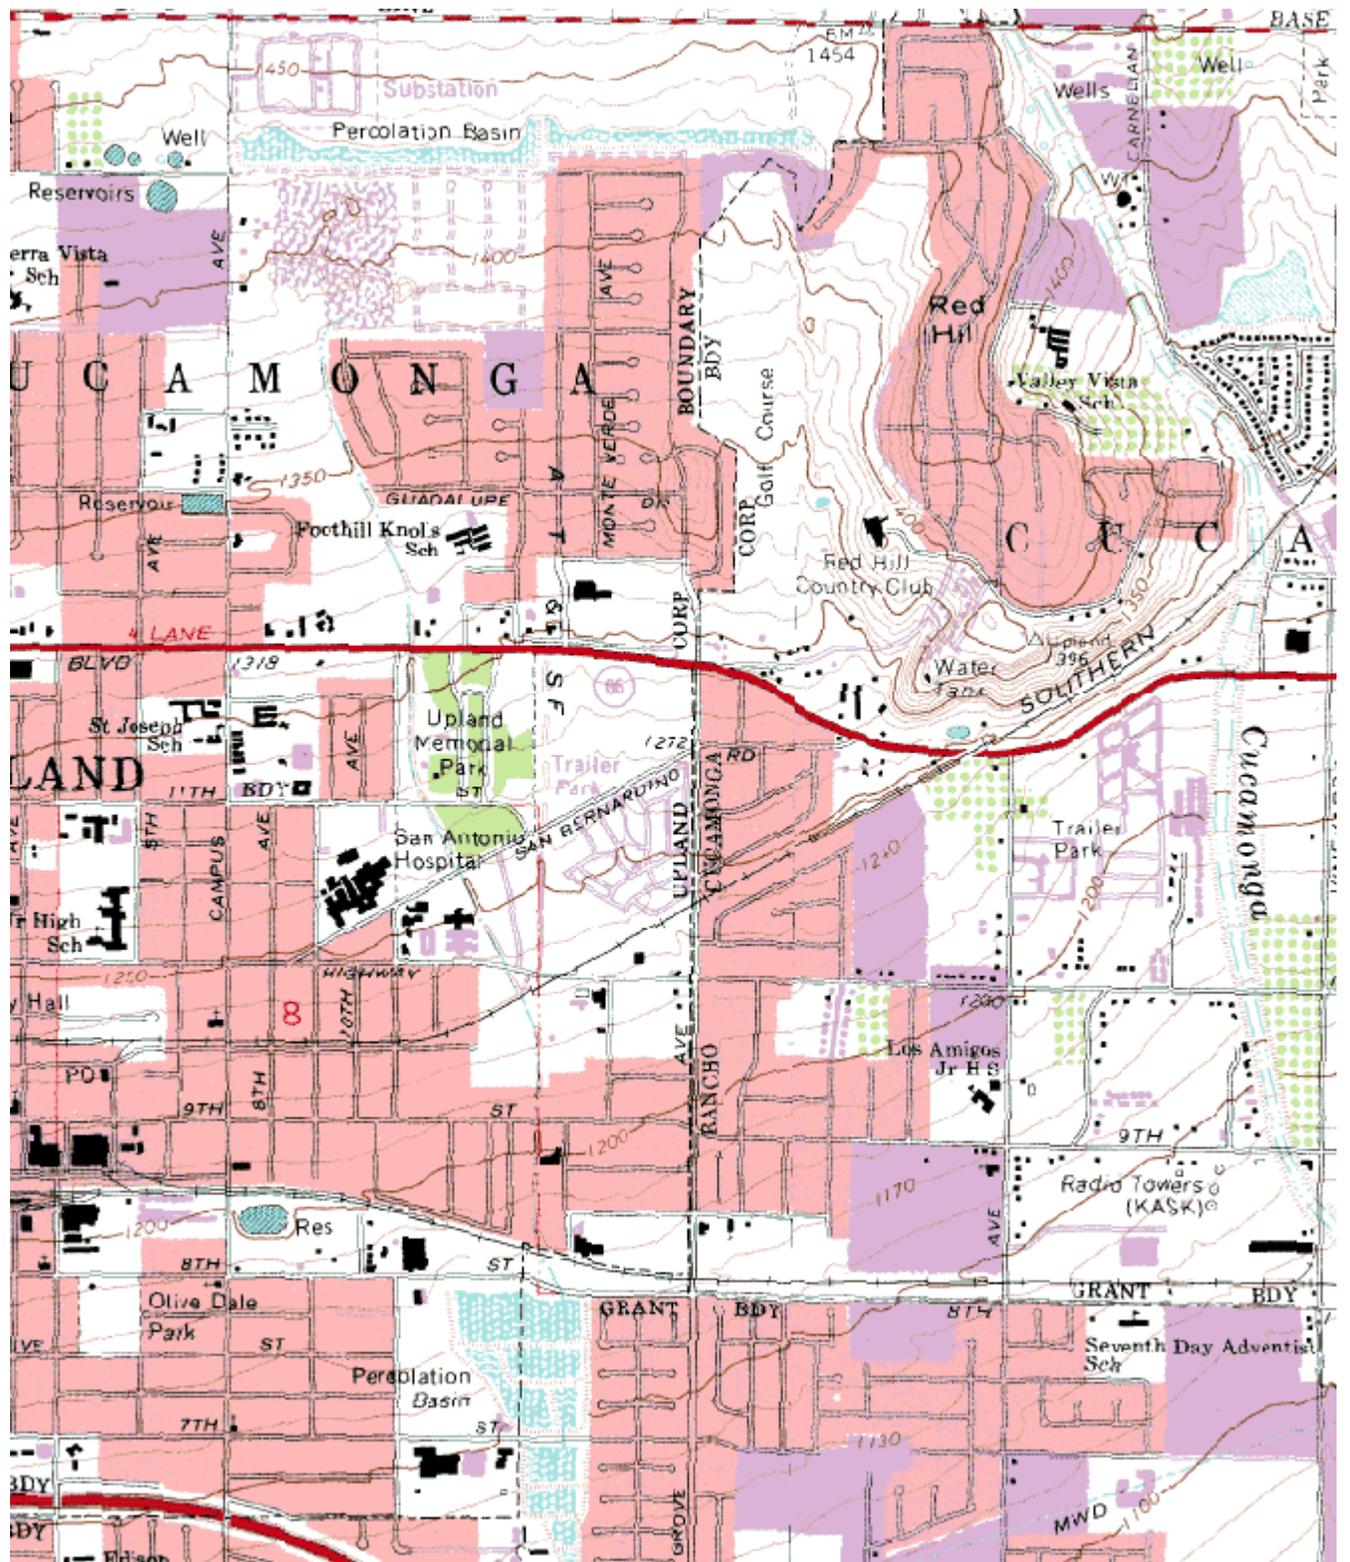

## Detailed Site Information

Local site name	Upland			
AQS ID	060711004			
GPS coordinates (decimal degrees)	Latitude: 34° 06' 13" Longitude: 117° 37' 45"			
Street Address	1350 San Bernardino Rd, #62, Upland, CA 91786			
County	San Bernardino			
Distance to roadways (meters)	80			
Traffic count (AADT, year)	10,000 / 2012			
Groundcover (e.g. asphalt, dirt, sand)	Gravel			
Representative statistical area name (i.e. MSA, CBSA, other)	40140-Riverside-San Bernardino-Ontario, CA MSA			
Pollutant, POC	Carbon Monoxide, 1	Nitrogen Dioxide, 2	Ozone, 1	Continuous PM10, 3
Primary / QA Collocated / Other	N/A	N/A	N/A	Other
Parameter code	42101	42602	44201	81162
Basic monitoring objective(s)	NAAQS	NAAQS	NAAQS	NAAQS
Site type(s)	Population Exposure	Population Exposure	Population Exposure	Population Exposure
Monitor (type)	SLAMS	SLAMS	SLAMS	SLAMS
Network affiliation	N/A	N/A	N/A	N/A
Instrument manufacturer and model	Horiba APMA 370	Thermo Scientific 42i	API/Teledyne 400E	Met One BAM 1020
Method code	158	074	087	122
FRM/FEM/ARM/ other	FRM	FRM	FEM	FEM
Collecting Agency	SCAQMD	SCAQMD	SCAQMD	SCAQMD
Analytical Lab (i.e. weigh lab, toxics lab, other)	N/A	N/A	N/A	N/A
Reporting Agency	SCAQMD	SCAQMD	SCAQMD	SCAQMD
Spatial scale (e.g. micro, neighborhood)	Neighborhood	Neighborhood	Neighborhood	Neighborhood
Monitoring start date (MM/DD/YYYY)	03/1973	03/1973	03/1973	04/02/2010
Current sampling frequency (e.g. 1:3, continuous)	1:1	1:1	1:1	1:1
Calculated sampling frequency (e.g. 1:3/1:1)	N/A	N/A	N/A	N/A
Sampling season (MM/DD-MM/DD)	01/01-12/31	01/01-12/31	01/01-12/31	01/01-12/31
Probe height (meters)	4.7	4.7	4.7	5.1
Distance from supporting structure (meters)	1.3	1.3	1.3	1.7
Distance from obstructions on roof (meters)	N/A	N/A	N/A	N/A

Distance from obstructions not on roof (meters)	N/A	N/A	N/A	N/A
Distance from trees (meters)	N/A	N/A	N/A	N/A
Distance to furnace or incinerator flue (meters)	N/A	N/A	N/A	N/A
Distance between collocated monitors (meters)	N/A	N/A	N/A	N/A
Unrestricted airflow (degrees)	360°	360°	360°	360°
Probe material for reactive gases (e.g. Pyrex, stainless steel, Teflon)	Teflon	Teflon	Teflon	N/A
Residence time for reactive gases (seconds)	8.4	11.4	9.2	N/A
Will there be changes within the next 18 months? (Y/N)	No	No	No	No
Is it suitable for comparison against the annual PM2.5? (Y/N)	N/A	N/A	N/A	N/A
Frequency of flow rate verification for manual PM samplers	N/A	N/A	N/A	N/A
Frequency of flow rate verification for automated PM analyzers	N/A	N/A	N/A	Monthly
Frequency of one-point QC check for gaseous instruments	Nightly	Nightly	Nightly	N/A
Last Annual Performance Evaluation for gaseous parameters (MM/DD/YYYY)	08/31/2016	08/31/2016	08/31/2016	N/A
Last two semi-annual flow rate audits for PM monitors (MM/DD/YYYY, MM/DD/YYYY)	N/A	N/A	N/A	06/24/2016, 12/11/2016

Pollutant, POC	Continuous PM2.5, 3	Lead, 1		
Primary / QA Collocated / Other	Other	N/A		
Parameter code	88502	14129		
Basic monitoring objective(s)	NAAQS	NAAQS		
Site type(s)	Population Exposure	Population Exposure		

Monitor (type)	SLAMS	SLAMS		
Network affiliation	N/A	N/A		
Instrument manufacturer and model	Met One BAM 1020	GMW 1200 TSP/Hi-Q		
Method code	731	110		
FRM/FEM/ARM/other	Non-FEM	FRM		
Collecting Agency	SCAQMD	SCAQMD		
Analytical Lab (i.e. weigh lab, toxics lab, other)	N/A	SCAQMD		
Reporting Agency	SCAQMD	SCAQMD		
Spatial scale (e.g. micro, neighborhood)	Neighborhood	Neighborhood		
Monitoring start date (MM/DD/YYYY)	05/08/2009	09/1990		
Current sampling frequency (e.g. 1:3, continuous)	1:1	1:6		
Calculated sampling frequency (e.g. 1:3/1:1)	N/A	1:6		
Sampling season (MM/DD-MM/DD)	01/01-12/31	01/01-12/31		
Probe height (meters)	5.1	2.9		
Distance from supporting structure (meters)	1.7	2.0		
Distance from obstructions on roof (meters)	N/A	N/A		
Distance from obstructions not on roof (meters)	N/A	N/A		
Distance from trees (meters)	N/A	N/A		
Distance to furnace or incinerator flue (meters)	N/A	N/A		
Distance between collocated monitors (meters)	N/A	N/A		
Unrestricted airflow (degrees)	360°	360°		
Probe material for reactive gases (e.g. Pyrex, stainless steel, Teflon)	N/A	N/A		
Residence time for reactive gases (seconds)	N/A	N/A		
Will there be changes within the next 18 months? (Y/N)	No	No		

Is it suitable for comparison against the annual PM2.5? (Y/N)	N/A	N/A		
Frequency of flow rate verification for manual PM samplers	N/A	Monthly		
Frequency of flow rate verification for automated PM analyzers	Monthly	N/A		
Frequency of one-point QC check for gaseous instruments	N/A	N/A		
Last Annual Performance Evaluation for gaseous parameters (MM/DD/YYYY)	N/A	N/A		
Last two semi-annual flow rate audits for PM monitors (MM/DD/YYYY, MM/DD/YYYY)	06/24/2016, 12/11/2016	05/05/2016, 11/05/2016		

**Upland  
Site Photos**



**Looking North from the probe.**



**Looking East from the probe.**



**Looking South from the probe.**



**Looking West from the probe.**


**Upland  
Site Photos (Cont.)**



**Looking at the probe from the North.**



**Looking at the probe from the East.**

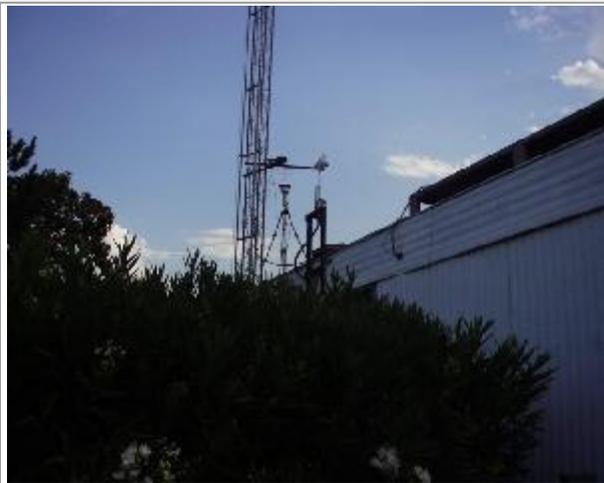

**Looking at the probe from the South.**



**Looking at the probe from the West.**